

1988/1989 GL1500 IMPROVED WINDSHIELD SEAL

(This supersedes GL1500 #5, dated November 1989)

An improved windshield seal for 1988 and 1989 GL1500s is now available. This thicker seal is used on the 1990 GL and helps retain the shield in its fixed position.

In addition to the new seal, properly adjusting the windshield lever anchor screws will prevent a loose or slipping shield.

APPLICABLE MOTORCYCLES


All 1988/1989 GL1500s

REPAIR PROCEDURE

NOTE: Use the 1988 or 1989 GL1500 Service Manual (section I3) for reference.

1. Remove the mirrors.
2. Remove the black plastic vent trim.
3. Remove the two screws securing the windshield trim. Free the tabs from the fairing slots and remove the trim.
4. Remove the existing seal from the back of the trim. Clean the windshield and seal mating surfaces with warm soap and water — dry completely.

NOTE: Do not use petroleum-based cleaning products on the shield.

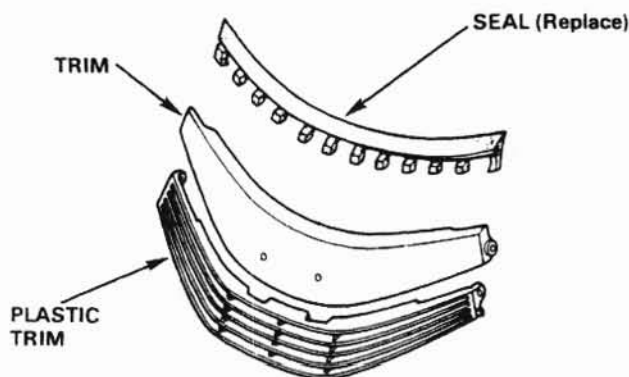

5. Peel off the tape backing on the new seal. Press the seal into position on the trim.

6. Slide the trim tabs into the fairing slots and secure the trim with the two screws.
7. Adjust the windshield lever anchor screws according to service manual page 13-4.
8. Install the plastic vent trim and the mirrors.

PARTS INFORMATION

Windshield Seal
P/N: 64111-MT8-000
H/C: 3234622

WARRANTY INFORMATION

The normal warranty policy and procedures apply. If you feel that goodwill consideration is appropriate, contact SWAT (see page 3-3 in the Warranty Policy and Procedures Manual) before starting this repair.

Submit a claim form with the following information:

Contention Code: 12K
Defect Code: 061
Failed Part Number: 64111-MN5-000
Failed Honda Code: 2808889
Labor Operation Number: 411115 **NEW**
Flat Rate Time: 0.4 hour

MTB 4912-4938 (8911)

ROUTING:

COPY 1

COPY 2

GENERAL MANAGER
 SERVICE MANAGER

SALES DEPT.
 MECHANICS

OFFICE FILE
 SHOP MANUAL

goldwingdocs.com