



# SERVICE BULLETIN

AMERICAN HONDA MOTOR CO., INC. MOTORCYCLE SERVICE DEPARTMENT

## GL1500 CB RADIO SUB-HARNESS

Owners of GL1500s with the optional CB radio may complain about transmission and reception quality, such as garbled voice transmission, excessive microphone wind noise and ACG/ignition static.

A new CB radio sub-harness is available to improve these conditions. The sub-harness includes an in-line capacitor, resistor and ground wires.

### AFFECTED CB RADIOS

CB radios with serial numbers up to 6655.

NOTE: CBs above this number have been manufactured with internal improvements and do not need this repair.

### PARTS INFORMATION

Sub-Harness Kit (1 required)  
P/N: 08118-MN500AS  
H/C: 3113479

Includes the following:

- Sub-Harness
- Installation instructions

### WARRANTY INFORMATION


The normal warranty policies and procedures apply. Submit a claim form with the following information:

Contention Code: 01C  
Defect Code: 066  
Failed Honda Code: 2801603  
Failed Part Number: 08118-MN500  
Labor Operation Number: 619180  
Flat Rate Time: 0.7 hour

NOTE: The optional CB radio has a one-year warranty from the date of installation.

### REPAIR PROCEDURE

Installation instructions are included with the sub-harness kit. Follow the instructions carefully for proper sub-harness installation.

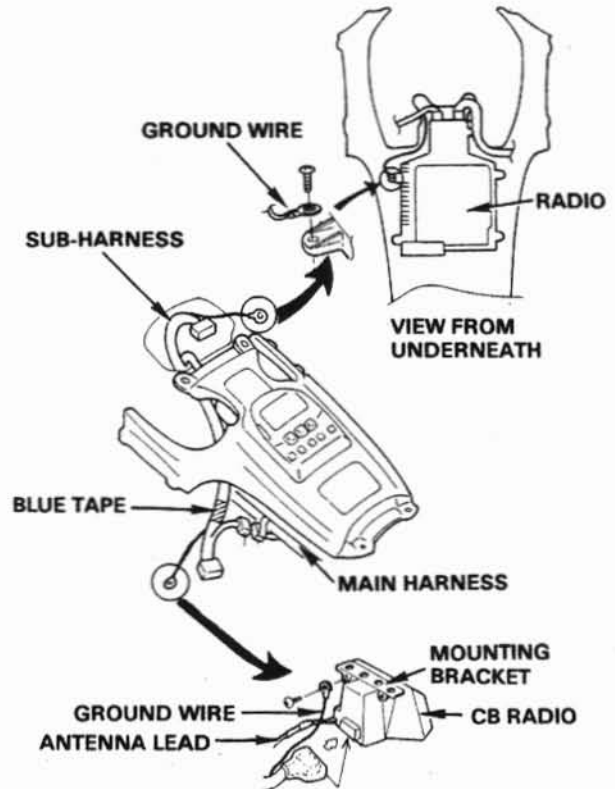

### IDENTIFICATION

For future identification, remove the left fairing side pocket. A ground wire attached to the CB mounting bracket indicates the new sub-harness (or a CB with serial number 6656 or above) has already been installed. The sub-harness for this repair is also wrapped with blue tape in the area shown above.

goldwingdocs.com

### ROUTING:

COPY 1

COPY 2

- GENERAL MANAGER  
 SERVICE MANAGER

- SALES DEPT.  
 MECHANICS

- OFFICE FILE  
 SHOP MANUAL